



Questions, call : 1-800-MOTO-USA

<http://www.cannondale.com/motorsports>

Cannondale Motorsports Technical Bulletin


BULLETIN : TB02-005

MODELS : All 2001, 2002 ATVs

ISSUED : 2/22/02

SUBJECT : Air filter servicing and electronics tray seal quality

CONDITION : After servicing the air filter, inspect the quality of the seal between the reinstalled front fender (cowl) and the electronics tray. If the front fender has been damaged, the fender bracket has shifted or been bent inadvertently, or if the seal itself has been damaged, water and or other contaminants can be introduced into the electronics tray possibly damaging the components. After installing the front fender, visually check the seal quality along its entire length. Make sure there are no gaps or damage to the seal. The seal should be compressed enough to provide a positive water-tight seal. If not, it may be necessary to remove the fender mounting hardware, loosen the upper front shock bolt, and correct the bracket height to increase the pressure the installed fender exerts on the seal. When washing the vehicle, do not spray any water directly at the seal.

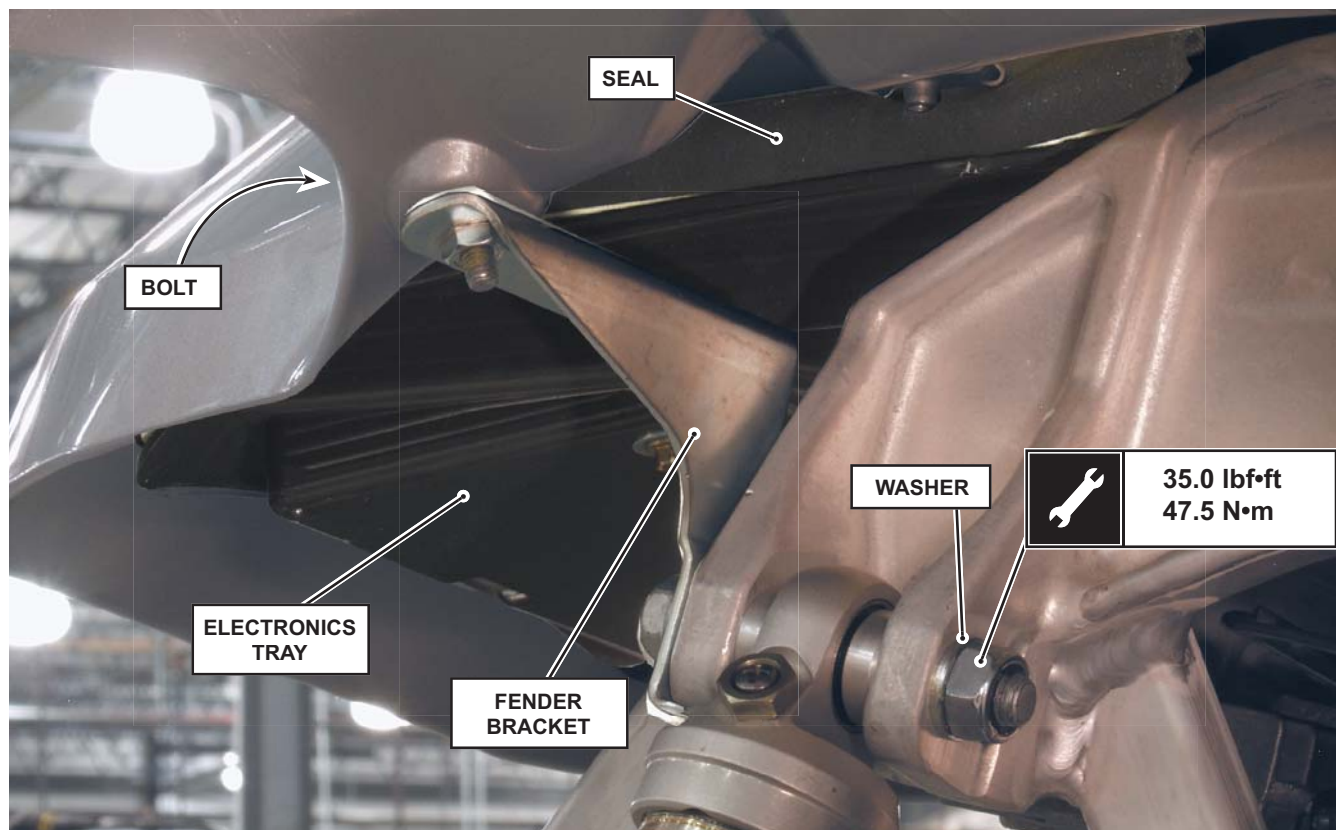

Information is subject to change without notice.

